




A Series V7

Features

- High-end Multi-touch experience (truly support 2/4/6/10/12/16/32/40 simultaneous touch points)
- Strong ambient light immunity up to 150,000lux
- Fast response
- Support remote control and remote diagnosis
- Easy Integration
- HID* plug & play driver free capability

Application

- Digital Signage
- Kiosk
- Exhibitions
- TV Channels
- Education Whiteboard
- Command Center and Boardroom
- Commercial Transportation

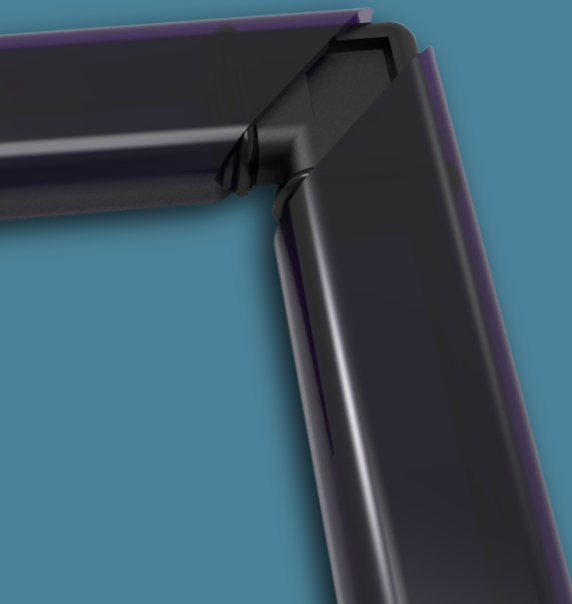

Tel : +86 572 2671007

E-Mail : sales@zaagtech.com

Website : www.zaagtech.com

Add : 1573 Hongfeng Road, Huzhou, Zhejiang, China

Touch Panel

Standard Size	32"- 103"
Dimension	19.8mm width, 11.4mm thickness (with frame, without glass)
Number of Touch Points	2, 4, 6, 10, 12, 16, 32, 40
Minimum Touch Object	5mm
Touch Activation Force	No minimum touch pressure required
Touch Durability	Unlimited
Resolution	32768*32768
Driver Free	HID* compatible, up to 40 touch points
Linearity Deviation	±1mm
Fault Tolerance	Workable even 75% sensors are damaged
Frames per Second	Up to 450 fps
Typical Response Time	3-10ms
Light Transmission	100% without glass
Operating Systems	Windows®7, Windows®8, Windows®10, Vista, XP, Mac® OS, Linux, Android
Protocols	HID, TUIO, Flash
Re-development	Provide free SDK, support C/C++, C#, Java etc.
Warranty**	2 years limited warranty on parts and labor

Electrical

Power Supply	Single USB Connection
Low Power Consumption	Operating ≤2W, Stand By ≤ 250mW
ESD	Per EN61000-4-21995; Level 4. Contact Discharge 8kV, Air Discharge 15kV 15kV on USB Connector pins

Environment

Temperature	Operating Temperature: -20°C~70°C Storage Temperature: -40°C~85°C
Humidity	Operating Humidity: 10%~90%RH(Non-condensing) Storage Humidity: 10%~90%RH
Certification	FC CE RoHS
Protection Grade	IP65

*HID compatible is available under Windows, Linux and Android OS.

For Windows XP and other platforms that do not support multi-touch, a mouse HID protocol is provided.

Warranty** for A series multi-touch overlay excludes coverage for damage resulting from accident, alcohol damage, disassembly, unauthorized service and unauthorized modifications.